 


COMPUTER NUMERICAL CONTROL PROGRAMMING BASICS



A Primer for the
SkillsUSA/VICA
Championships



Steve Krar ■ Arthur Gill

*Distributed to educational administrators,
instructors, students, and apprentices
with the compliments of*

INDUSTRIAL PRESS, INC.
publishers of
MACHINERY'S HANDBOOK
"The Bible of the Machine Trades"

CALL FOR AUTHORS

Industrial Press is expanding its list of professional and educational titles in addition to starting a new program in electronic publishing. If you have any suggestions or actual writing plans, we encourage you contact us.

We are seeking new authors especially in the following fields:

CNC and CAD/CAM
Design
Electrical/Electronics
Industrial Engineering
Machine Shop/Tools/Metalworking
Maintenance
Manufacturing
Technical Mathematics
Quality Control/Reliability
Welding

Industrial Press provides specialized and personal assistance in all stages of book publishing from writing the text, to layout, design and marketing. We give authors the individualized attention needed in producing quality publications, and actively promote books to national and international markets.

For more information about submitting a proposal, please contact us and we will forward our suggested guidelines:

John Carleo
Editor
Industrial Press, Inc.
200 Madison Avenue
New York, NY 10016-4078

Toll Free: 888-528-7852 ext. 18
Tel: 212-889-6330 ext.18
Fax: 212-545-8327
carleoip@aol.com
www.industrialpress.com

Computer Numerical Control Programming Basics

Steve Krar ■ Arthur Gill

This book is not intended for sale under any circumstances.

INDUSTRIAL PRESS INC.
200 Madison Avenue, New York, NY 10016

Photo Credits - Allen Bradley, Deckel Maho Inc., Denford Inc., Emco Maier Corp., Icon Corp., Kelmar Associates, Superior Electric Co.

Development Resources provided by Paul Koontz, Denford Inc.
Page Layout / Design - Coree Kilo Price, Denford Inc.

Library of Congress Cataloging-in-Publication Data

Krar, Steve F.

COMPUTER Numerical Control Programming Basics / Steve Krar, Arthur Gill.

p. cm.

ISBN 0-07-023333-0

1. Machine Tools - Numerical Control. I. Gill, Arthur, date. II Title.

TJ1189, K74 1999

89-12571

CIP

Some of the artwork for this book was processed electronically.

Computer Numerical Control Programming Basics

Copyright © 1999 by Kelmar Associates. All rights reserved.

Printed in the United States of America. Except as permitted under the United States Copyright Act, no part of this publication can be reproduced or distributed in any form or means, or stored in a database or retrieval system without the written permission of the publisher.

Send all inquiries to:

Kelmar Associates

420 Fitch Street, Welland, ON L3C 4W8

Phone: (905) 732-4193

E-mail: skrar@netcom.ca

Industrial Press Edition ISBN 0-8311-3131-4

CONTENTS

<i>SECTION</i>	<i>PAGE</i>
Foreword	1
Preface	7
Cartesian Coordinate System	7
Machines Using CNC	9
Programming Systems	11
Point-to-Point or Continuous Path	13
Point-to-Point Positioning	14
Continuous Path (Contouring)	15
Interpolation	15
Programming Format	17
Programming for Positioning	23
Work Settings and Offsets	26
CNC Bench-Top Milling and Turning Centers	30
CNC Programming Hints — Milling	32
Milling and Drilling Programming	34
CNC Programming Hints – Turning	38
Fanuc Compatible Programming	39
Turning Programming	40

CNC Foreword

As the National Technical Committee Chairman for the Precision Machining Technology portion of the Skills USA-VICA championships I get to see students of varying levels of competence compete each year. Each year my Industry committee works very hard to design a competition that is challenging but fair. Since both Secondary and Post-Secondary students compete at the Nationals, the level of difficulty is always a topic of discussion. Of major concern are the low scores in the CNC programming sections of this national competition. Only basic CNC programming skills are required to complete these portions of the competition. However, the scores indicate that too many competitors **do not have these basic skills**. Because the committee feels a responsibility to help educators provide this basic knowledge to students interested in manufacturing technology, the committee suggested that this booklet be furnished to all Skills USA-VICA State Directors and all instructors with a machining curriculum in that state.

This book can be photocopied with the written permission from Kelmar Associates so that as many students as possible can be exposed to this basic information; It is not for resale. The information should also be furnished to all local and state precision machining technical committees so they can incorporate CNC Programming in their competitions. The information is also available on the Skills USA-VICA Precision Machining Technology web site.

The 1999 National competition had two CNC programming stations as part of the overall Precision Machining Technology portion of the Skills USA Championships. Each of these CNC Programming sections was worth 100 points. CNC programming represents 28% of the National competition. Contestants sent to the nationals without this basic skill have no chance of winning a medal and would have difficulty receiving a passing grade.

CNC TURNING: The average score of the secondary contestants was 32.4 with the highest score being 100 and the lowest being six contestants with zeros. The post-secondary scores were higher, but still not where they should be. The average was 52.9, with the highest score being 99 and the lowest being two contestants with zeros.

CNC MILLING: The Milling programming scores were even lower. Secondary average was 25.8 with a high of 100 and five contestants with zeros. Post-secondary average was 25.7 with a high of 58 and four contestants with zero.

These scores indicate a definite lack of fundamental CNC programming skills!

All contestants were given a guide to the Fanuc software that would be used. The Fanuc software guide, that is used in over 80% of the CNC applications throughout the world, included all the codes needed for the competition. Contestants were given time to familiarize themselves with and ask questions about the computers and the software they would be using. Technical committee members were shocked to find several contestants that did not even have the basic computer skills to open the software program.

It is our recommendation that any school with a Precision Machining curriculum should be utilizing manual machines to provide a basic understanding of and to develop basic skills related to the fundamental machining processes. The focus of this phase should be work-holding techniques, how metal is removed, tooling terminology, proper speeds, feed and depth of cut for different materials and obtaining geometric and size tolerances. After this basic introduction to machining processes (utilizing manual machines) instruction should quickly transition to CNC programming utilizing and applying all the fundamental machining skills learned in the manual-machining phase.

We are not suggesting that every school with a metalworking program invest in costly full-sized CNC machines; just the opposite is true. Inexpensive text books, trade literature, video tapes, machine simulators (this is how the small bench-top CNC teaching machines should be looked upon), and computer software is available today. We also feel that the NIMS (National Institute for Metalworking Skills) Machining, level I and II skill standards should be incorporated into every school's machining program.

Our National Skills USA Precision Machining Competition is based on these standards!

Visit the NIMS web site: www.nims-skills.org

It is our hope that this booklet will get into the hands of all those instructors, advisors, State Directors and local and state technical committees that have anything to do with the Skills USA-VICA Precision Machining competition and eventually into every precision machining curriculum in the United States.

Why CNC (Computer Numerical Control)?

It has been a privilege to be part of the Precision Machining Technology Competition for the past 9 years. I am proud to have the opportunity of working with the fine young people from all parts of the United States. They deserve the best that the educational system and VICA can provide to prepare them for a future in this rapidly changing technological world and make their contribution to the country's economy.

My enthusiasm for VICA and the young competitors is still very strong, however there seems to be a serious lack of preparation for students from metalworking/manufacturing related courses in the basic knowledge of CNC. CNC, not a new technology having been around since 1957, is one of the key factors in the manufacture of most products in the world today. A knowledge of CNC, for a technology student, should rank in importance along with the ability of speaking proper English and reading technical prints (blueprints).

As a former educator and now the Team Leader of the CNC VICA competition, I feel so sorry for contestants in the Milling and Turning who sit in front of a computer and do not know how to load a program or the basics of CNC programming. These students are naturally frustrated that an educational system has shortchanged them by not realizing that metalworking technology has changed dramatically over the past 40 years. That some schools prepare students for the National VICA Precision Machining Competition with 50-year-old technical knowledge is something very difficult to understand.

The International (World) competition eliminated conventional machine tools from the precision machining competition in 1996, and it now consists of 100% CNC competition. To send our national winner to the world competition without a good background in CNC programming and machining would be a reflection on, and a disgrace to the US educational system.

The educational community and National VICA must work together to correct this lack of CNC knowledge and training. The

VICA CNC Programming Guide covers the basic CNC principles and gives detailed explanation of each step in the programming and turning a part. The time and money spent to prepare and distribute this Guide will be wasted unless the metalworking/manufacturing teacher is committed to introducing CNC as part of the curriculum.

The following suggestions can be used to introduce CNC theory and technology to metalworking/manufacturing courses:

1. Teach the basics of CNC using the VICA CNC Programming Guide that should be supplemented by a textbook, visuals, video-tapes, etc. - COST approximately \$200.00.
2. Use the VICA CNC Programming Guide and textbook along with CAD/CAM software that allows a student to simulate the machining of a programmed part on the computer screen. - COST approximately \$600.00.
3. Use the VICA CNC Programming Guide, textbook, CAD/CAM software, plus a CNC Bench-Top teaching size machine. This is by far the best method since students can actually produce a real part that they can hold and take home to show their parents. - COST approximately \$6,000.00

For more information from a leader in CNC educational courseware, software, and Bench-Top Teaching machines contact:

Denford Inc.
1-800-886-9750
www.denford.com
E-mail: sales@denford.com

The old argument that there are still many shops using old technology is a fallacy used consciously or unconsciously by those resisting changes. Over 90% of the machine tools manufactured in the world have some form of CNC control, therefore conventional (manual) machines should be used to provide only the basic knowledge of machines and machining processes.

We must all do our part; State Directors, District Directors, School Administrators, and Classroom Teachers to correct a problem long overdue in technical education.

Steve Krar
CNC Team Leader
Precision Machining Technology

Preface

The term *numerical control* is a widely accepted and commonly used term in the machine tool industry. Numerical control (NC) enables an operator to communicate with machine tools through a series of numbers and symbols.

NC which quickly became Computer Numerical Control (CNC) has brought tremendous changes to the metalworking industry. New machine tools in CNC have enabled industry to consistently produce parts to accuracies undreamed of only a few years ago. The same part can be reproduced to the same degree of accuracy any number of times if the CNC program has been properly prepared and the computer properly programmed. The operating commands which control the machine tool are executed automatically with amazing speed, accuracy, efficiency, and repeatability.

The ever-increasing use of CNC in industry has created a need for personnel who are knowledgeable about and capable of preparing the programs which guide the machine tools to produce parts to the required shape and accuracy. With this in mind, the authors have prepared this textbook to take the mystery out of CNC - to put it into a logical sequence and express it in simple language that everyone can understand. The preparation of a program is explained in a logical step-by-step procedure, with practical examples to guide the student.

Cartesian Coordinate System

Almost everything that can be produced on a conventional machine tool can be produced on a computer numerical control machine tool, with its many advantages. The machine tool movements used in producing a product are of two basic types: *point-to-point* (straight-line movements) and *continuous path* (contouring movements).

The Cartesian, or rectangular, coordinate system was devised by the French mathematician and philosopher Rene' Descartes. With this system, any specific point can be described in mathematical

terms from any other point along three perpendicular axes. This concept fits machine tools perfectly since their construction is generally based on three axes of motion (X, Y, Z) plus an axis of rotation. On a plain vertical milling machine, the X axis is the horizontal movement (right or left) of the table, the Y axis is the table cross movement (toward or away from the column), and the Z axis is the vertical movement of the knee or the spindle. CNC systems rely heavily on the use of rectangular coordinates because the programmer can locate every point on a job precisely.

When points are located on a workpiece, two straight intersecting lines, one vertical and one horizontal, are used. These lines must be at right angles to each other, and the point where they cross is called the *origin*, or *zero point* (Fig. 1)

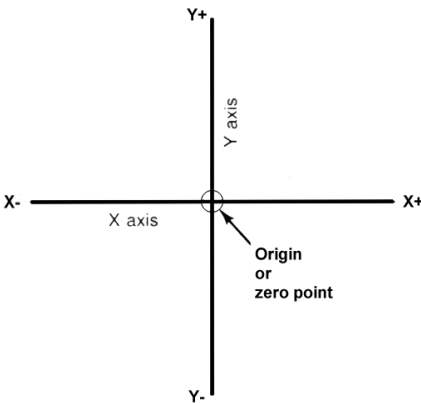


Fig. 1 Intersecting lines form right angles and establish the zero point (Allen-Bradley)

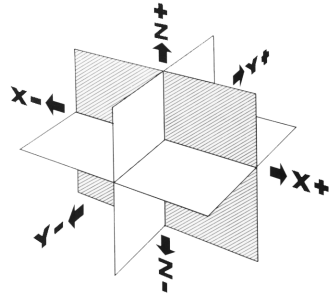


Fig. 2 The three-dimensional coordinate planes (axes) used in CNC. (The Superior Electric Company)

The three-dimensional coordinate planes are shown in Fig. 2. The X and Y planes (axes) are horizontal and represent horizontal machine table motions. The Z plane or axis represents the vertical tool motion. The plus (+) and minus (-) signs indicate the direction from the zero point (origin) along the axis of movement. The four quadrants formed when the XY axes cross are numbered in a counterclockwise direction (Fig. 3). All positions located in quadrant 1 would be positive (X+) and positive (Y+). In the second quadrant, all positions would be negative X (X-) and positive (Y+). In the third quadrant, all locations would be negative X (X-) and negative (Y-). In the fourth quadrant, all locations would be positive X (X+) and negative Y (Y-).

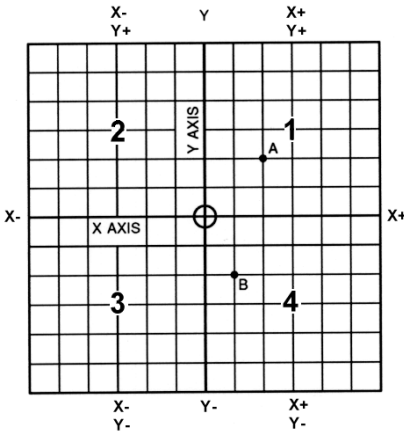


Fig. 3 The quadrants formed when the X and Y axes cross are used to accurately locate points from the XY zero, or origin, point. (Allen-Bradley)

In Fig. 3 , point A would be 2 units to the right of the Y axis and 2 units above the X axis. Assume that each unit equals 1.000. The location of point A would be X + 2.000 and Y + 2.000. For point B, the location would be X + 1.000 and Y - 2.000. In CNC programming it is not necessary to indicate plus (+) values since these are assumed. However, the minus (-) values must be indicated. For example, the locations of both A and B would be indicated as follows:

- A X2.000 Y2.000
- B X1.000 Y-2.000

Machines Using CNC

Early machine tools were designed so that the operator was standing in front of the machine while operating the controls. This design is no longer necessary, since in CNC the operator no longer controls the machine tool movements. On conventional machine tools, only about 20 percent of the time was spent removing material. With the addition of electronic controls, actual time spent removing metal has increased to 80 percent and even higher. It has also reduced the amount of time required to bring the cutting tool into each machining position.

Machine Types

Lathe

The engine lathe, one of the most productive machine tools, has always been an efficient means of producing round parts (Fig. 4). Most lathes are programmed on two axes.

- The X axis controls the cross motion of the cutting tool. Negative X (X-) moves the tool towards the spindle centerline; positive X moves the tool away from the spindle centerline.
- The Z axis controls the carriage travel toward or away from the headstock.

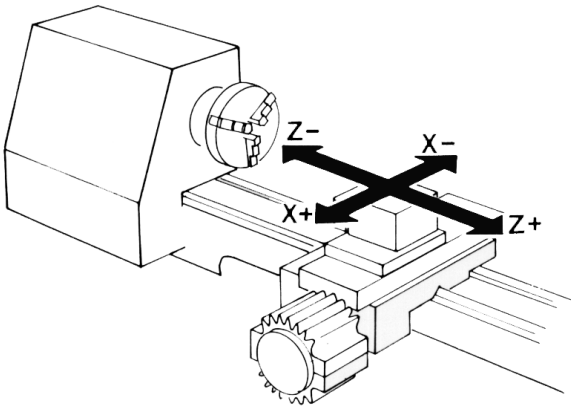


Fig. 4 The main axes of a lathe or turning center. (Emco Maier Corp)

Milling Machine

The milling machine has always been one of the most versatile machine tools used in industry (Fig. 5). Operations such as milling, contouring, gear cutting, drilling, boring, and reaming are only a few of the many operations which can be performed on a milling machine. The milling machine can be programmed on three axes:

- The X axis controls the table movement left or right.
- The Y axis controls the table movement toward or away from the column.
- The Z axis controls the vertical (up or down) movement of the knee or spindle.


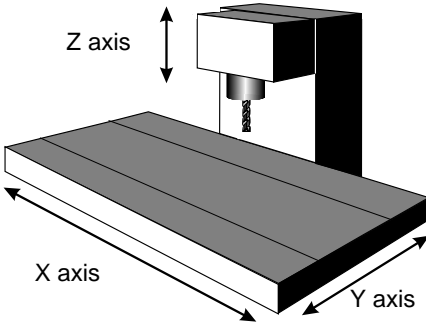


Fig. 5 The main axes of a vertical machining center. (Denford Inc.)

Programming Systems

Two types of programming modes, the incremental system and the absolute system, are used for CNC. Both systems have applications in CNC programming, and no system is either right or wrong all the time. Most controls on machine tools today are capable of handling either incremental or absolute programming.

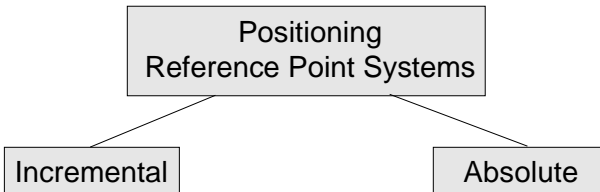

Incremental program locations are always given as the distance and direction from the immediately preceding point (Fig. 6). Command codes which tell the machine to move the table, spindle, and knee are explained here using a vertical milling machine as an example:

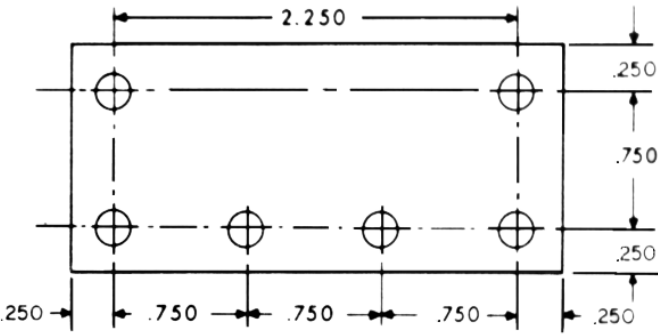


Fig. 6 A workpiece dimensioned in the incremental system mode. (Icon Corporation)

- A “X plus” (X+) command will cause the cutting tool to be located to the right of the last point.
- A “X minus” (X-) command will cause the cutting tool to be located to the left of the last point.
- A “Y plus” (Y+) command will cause the cutting tool to be located toward the column.
- A “Y minus” (Y-) will cause the cutting tool to be located away from the column.
- A “Z plus” (Z+) command will cause the cutting tool or spindle to move up or away from the workpiece.
- A “Z minus” (Z-) moves the cutting tool down or into the workpiece.

In incremental programming, the G91 command indicates to the computer and MCU (Machine Control Unit) that programming is in the incremental mode.

Absolute program locations are always given from a single fixed zero or origin point (Fig. 7). The zero or origin point may be a position on the machine table, such as the corner of the worktable or at any specific point on the workpiece. In absolute dimensioning and programming, each point or location on the workpiece is given as a certain distance from the zero or reference point.

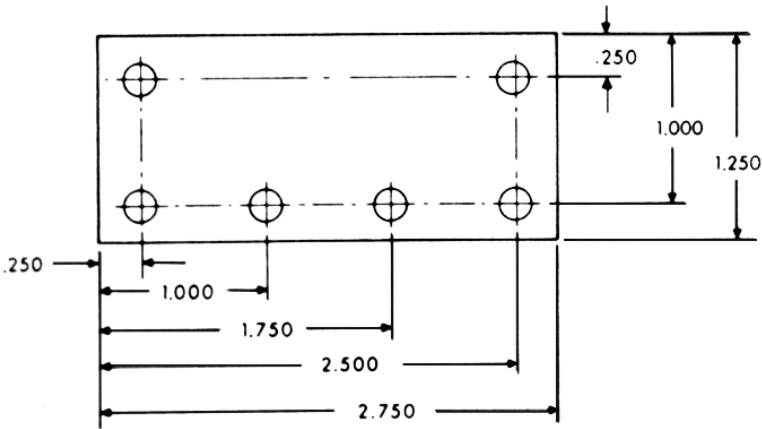


Fig. 7 A workpiece dimensioned in the absolute system mode. Note: All dimensions are given from a known point of reference. (Icon Corporation)

- A “X plus” (X+) command will cause the cutting tool to be located to the right of the zero or origin point.
- A “X minus” (X-) command will cause the cutting tool to be located to the left of the zero or origin point.
- A “Y plus” (Y+) command will cause the cutting tool to be located toward the column.
- A “Y minus” (Y-) command will cause the cutting tool to be located away from the column.

In absolute programming, the G90 command indicates to the computer and MCU that the programming is in the absolute mode.

Point-to-Point or Continuous Path

CNC programming falls into two distinct categories (Fig. 8). The difference between the two categories was once very distinct. Now, however, most control units are able to handle both point-to-point and continuous path machining. A knowledge of both programming methods is necessary to understand what applications each has in CNC.

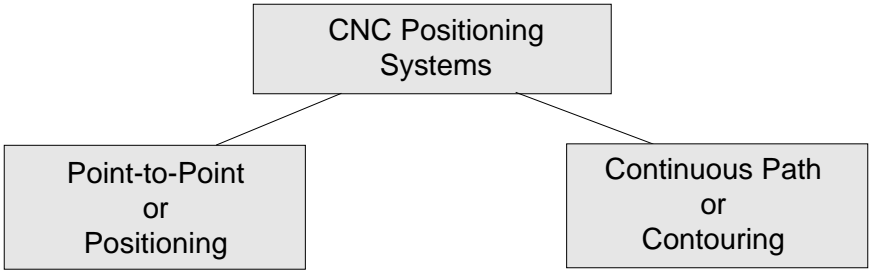


Fig. 8 Types of CNC positioning systems (Kelmar Associates)

Point-to-Point Positioning

Point-to-point positioning is used when it is necessary to accurately locate the spindle, or the workpiece mounted on the machine table, at one or more specific locations to perform such operations as drilling, reaming, boring, tapping, and punching (Fig. 9). Point-to-point positioning is the process of positioning from one coordinate (XY) position or location to another, performing the machining operation, and continuing this pattern until all the operations have been completed at all programmed locations.

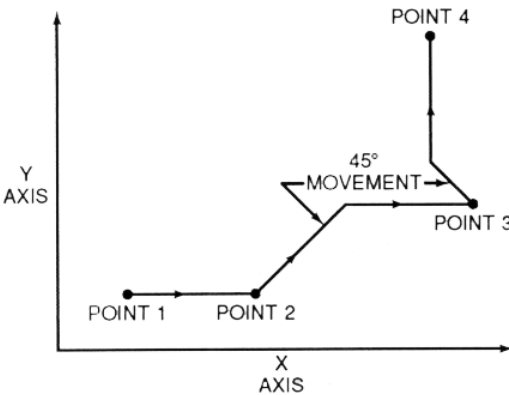


Fig. 9 The path followed by point-to-point positioning to reach various programmed points (machining locations) on the XY axis. (Kelmar Associates)

In Fig. 9 point 1 to point 2 is a straight line, and the machine moves only along the X axis; but points 2 and 3 require that motion along both the X and Y axes takes place. As the distance in the X direction is greater than in the Y direction, Y will reach its

position first, leaving X to travel in a straight line for the remaining distance. A similar motion takes place between points 3 and 4.

Continuous Path (Contouring)

Contouring, or *continuous path machining*, involves work such as that produced on a lathe or milling machine, where the cutting tool is in contact with the workpiece as it travels from one programmed point to the next. Continuous path positioning is the ability to control motions on two or more machine axes simultaneously to keep a constant cutter-workpiece relationship. The programmed information in the CNC program must accurately position the cutting tool from one point to the next and follow a predefined accurate path at a programmed feed rate in order to produce the form or contour required (Fig. 10)

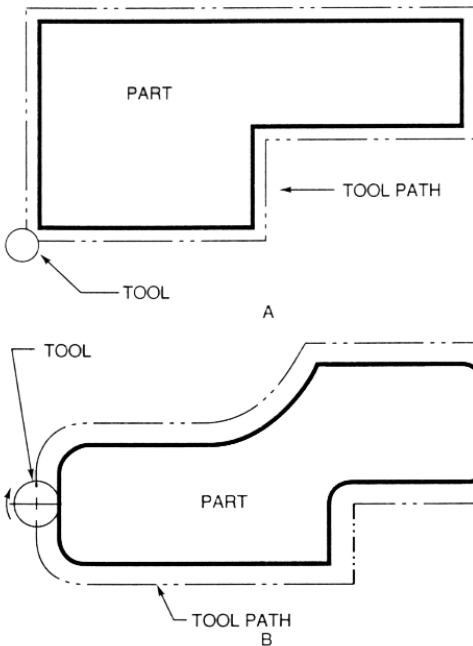


Fig. 10 Types of contour machining (A) Simple contour; (B) complex contour (Allen Bradley)

Interpolation

The method by which contouring machine tools move from one programmed point to the next is called *interpolation*. This ability to

merge individual axis points into a predefined tool path is built into most of today's MCUs. There are five methods of interpolation: linear, circular, helical, parabolic, and cubic. All contouring controls provide linear interpolation, and most controls are capable of both linear and circular interpolation. Helical, parabolic, and cubic interpolation are used by industries that manufacture parts which have complex shapes, such as aerospace parts and dies for car bodies.

Linear Interpolation

Linear Interpolation consists of any programmed points linked together by straight lines, whether the points are close together or far apart (Fig. 11). Curves can be produced with linear interpolation by breaking them into short, straight-line segments. This method has limitations, because a very large number of points would have to be programmed to describe the curve in order to produce a contour shape.

A contour programmed in linear interpolation requires the coordinate positions (XY positions in two-axis work) for the start and finish of each line segment. Therefore, the end point of one line or segment becomes the start point for the next segment, and so on, throughout the entire program.

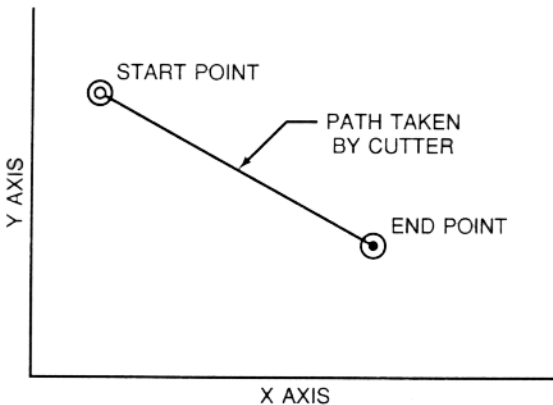


Fig. 11 An example of two-axis linear interpolation. (Kelmar Associates)

Circular Interpolation

The development of MCUs capable of *circular interpolation* has greatly simplified the process of programming arcs and circles. To program an arc (Fig. 12), the MCU requires only the coordinate positions (the XY axes) of the circle center, the radius of the circle, the start point and end point of the arc being cut, and the direction in which the arc is to be cut (clockwise or counterclockwise) See Fig. 12. The information required may vary with different MCUs.

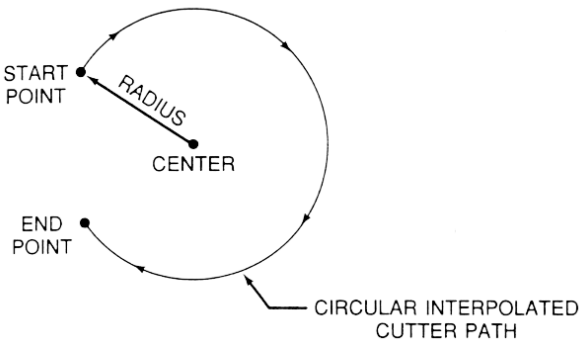


Fig. 12 For two-dimensional circular interpolation the MCU must be supplied with the XY axis, radius, start point, end point, and direction of cut. (Kelmar Associates)

Programming Format

Word address is the most common programming format used for CNC programming systems. This format contains a large number of different codes (preparatory and miscellaneous) that transfers program information from the part print to machine servos, relays, micro-switches, etc., to manufacture a part. These codes, which conform to EIA (Electronic Industries Association) standards, are in a logical sequence called a *block of information*. Each block should contain enough information to perform one machining operation.

Word Address Format

Every program for any part to be machined, must be put in a

format that the machine control unit can understand. The format used on any CNC machine is built in by the machine tool builder and is based on the type of control unit on the machine. A variable-block format which uses words (letters) is most commonly used. Each instruction word consists of an address character, such as X, Y, Z, G, M, or S. Numerical data follows this address character to identify a specific function such as the distance, feed rate, or speed value.

The address code G90 in a program, tells the control that all measurements are in the absolute mode. The code G91, tells the control that measurements are in the incremental mode.


Codes

The most common codes used when programming CNC machines tools are *G-codes* (preparatory functions), and *M codes* (miscellaneous functions). Other codes such as F, S, D, and T are used for machine functions such as feed, speed, cutter diameter offset, tool number, etc.



G-codes are sometimes called cycle codes because they refer to some action occurring on the X, Y, and/or Z axis of a machine tool, Fig. 13.

The G-codes are grouped into categories such as Group 01, containing codes G00, G01, G02, G03. which cause some movement of the machine table or head. Group 03 includes either absolute or incremental programming, while Group 09 deals with canned cycles.



A G00 code rapidly positions the cutting tool while it is above the workpiece from one point to another point on a job. During the rapid traverse movement, either the X or Y axis can be moved individually or both axes can be moved at the same time. Although the rate of rapid travel varies from machine to machine, it ranges between 200 and 800 in./min (5 and 20 m/min).

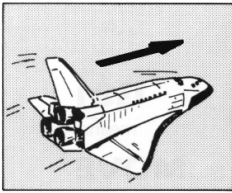



G00
RAPID TRAVERSE

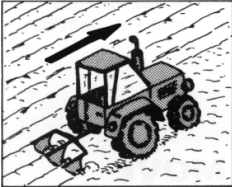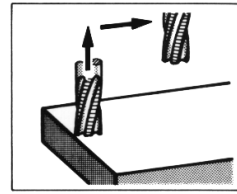

G01
LINEAR INTERPOLATION
(STRAIGHT LINE MOVEMENT)

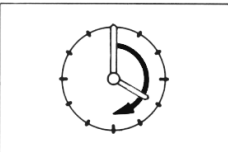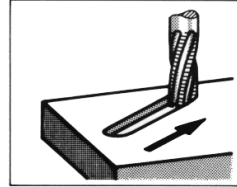

G02
CIRCULAR INTERPOLATION
(CLOCKWISE)

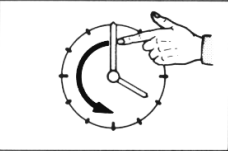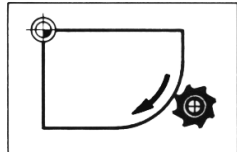

G03
CIRCULAR INTERPOLATION
(COUNTERCLOCKWISE)

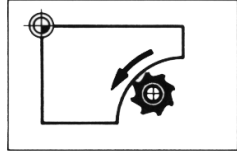


Fig. 13 The functions of a few common G-codes. (Deckel Maho, Inc.)

The G01, G02, and G03 codes move the axes at a controlled feedrate.

- G01 is used for straight-line movement (linear interpolation).
- G02 (clockwise) and G03 (counterclockwise) are used for arcs and circles (circular interpolation).

<u>Group</u>	<u>Code</u>	<u>Function</u>
01	G00	Rapid positioning
01	G01	Linear interpolation
01	G02	Circular interpolation clockwise (CW)
01	G03	Circular interpolation counterclockwise (CCW)
06	G20*	Inch input (in.)
06	G21*	Metric input (mm)
	G24	Radius programming (**)
00	G28	Return to reference point
00	G29	Return from reference point
	G32	Thread cutting (**)
07	G40	Cutter compensation cancel
07	G41	Cutter compensation left
07	G42	Cutter compensation right
08	G43	Tool length compensation positive (+) direction
08	G44	Tool length compensation minus (-) direction
08	G49	Tool length compensation cancel
	G84	Canned turning cycle (**)
03	G90	Absolute programming
03	G91	Incremental programming

(*) - on some machines and controls, these may be G70 (inch) and G71 (metric)

(**) - refers only to CNC lathes and turning centers.

Fig. 14 Some of the most common G-codes used in CNC programming.



M or miscellaneous codes are used to either turn ON or OFF different functions which control certain machine tool operations, Fig. 15.

M-codes are not grouped into categories, although several codes may control the same type of operations such as M03, M04, and M05 which control the machine tool spindle.



- M03 turns the spindle on clockwise
- M04 turns the spindle on counterclockwise
- M05 turns the spindle off





M03
DIRECTION OF ROTATION
(CLOCKWISE)

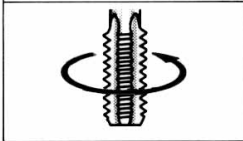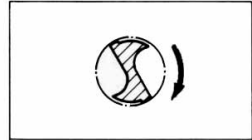

M04
DIRECTION OF ROTATION
(COUNTERCLOCKWISE)

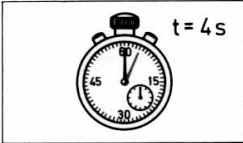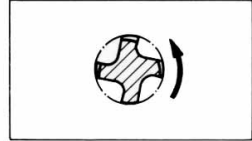

M06
TOOL CHANGE WITH
AUTOMATIC RETRACTION

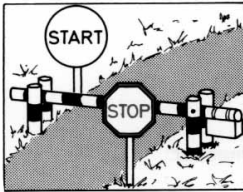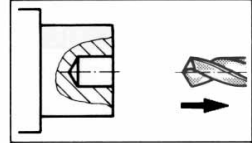

M30
END OF PROGRAM
AND
RETURN TO BEGINNING
OF PROGRAM

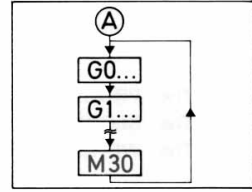


Fig. 15 The functions of a few common M-codes. (Deckel Maho, Inc.)

<u>Code</u>	<u>Function</u>
M00	Program stop
M02	End of program
M03	Spindle start (forward CW)
M04	Spindle start (reverse CCW)
M05	Spindle stop
M06	Tool change
M08	Coolant on
M09	Coolant off
M10	Chuck - clamping (**)
M11	Chuck - unclamping (**)
M12	Tailstock spindle out (**)
M13	Tailstock spindle in (**)
M17	Toolpost rotation normal (**)
M18	Toolpost rotation reverse (**)
M30	End of tape and rewind
M98	Transfer to subprogram
M99	End of subprogram

(**) - refers only to CNC lathes and turning centers.

Fig. 16 Some of the most common M-codes used in CNC programming.

Block of Information

CNC information is generally programmed in blocks of five words. Each word conforms to the EIA standards and they are written on a horizontal line. If five complete words are not included in each block, the machine control unit (MCU) will not recognize the information, therefore the control unit will not be activated.

Using the example shown in Fig. 17 , the five words are as follows:

- N001 represents the sequence number of the operation.
- G01 represents linear interpolation
- X12345 will move the table 1.2345 in. in a positive direction along the X axis.
- Y06789 will move the table 0.6789 in. along the Y axis.
- M03 Spindle on CW.

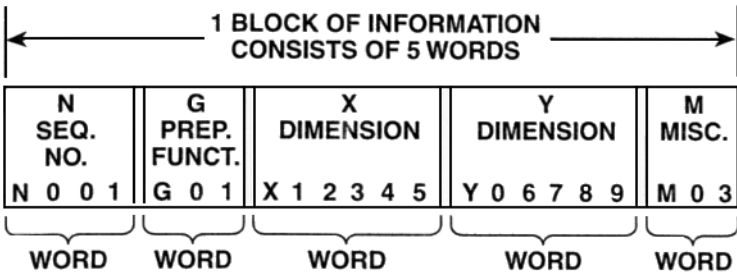


Fig. 17 A complete block of information consists of five words. (Kelmar Associates)

Programming for Positioning

Before starting to program a job, it is important to become familiar with the part to be produced. From the engineering drawings, the programmer should be capable of planning the machining sequences required to produce the part. Visual concepts must be put into a written manuscript as the first step in developing a part program, Fig. 18. It is the part program that will be sent to the machine control unit by the computer, tape, diskette, or other input media.


The programmer must first establish a reference point for aligning the workpiece and the machine tool for programming purposes. The manuscript must include this along with the types of cutting tools and work-holding devices required, and where they are to be located.

From the drawing to the workpiece

1. Reading drawing



2. Programming

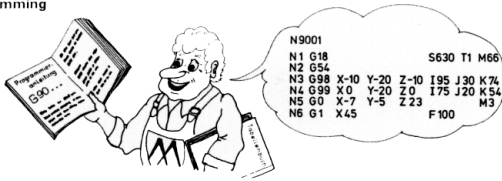

3. Inputting program



4. Manufacturing

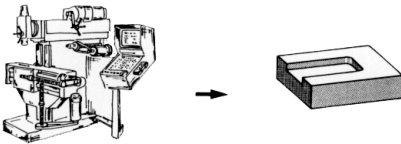


Fig. 18 The first step in producing a CNC program is to take the information from the print and produce a program manuscript. (Deckel Maho, Inc.)

Dimensioning Guidelines

The system of rectangular coordinates is very important to the successful operation of CNC machines. Certain guidelines should be observed when dimensioning parts for CNC machining. The following guidelines will insure that the dimensioning language means exactly the same thing to the design engineer, the technician, the programmer, and the machine operator.

1. Define part surfaces from three perpendicular reference planes.
2. Establish reference planes along part surfaces which are parallel to the machine axes.
3. Dimension from a specific point on the part surface.

4. Dimension the part clearly so that its shape can be understood without making mathematical calculations or guesses.
5. Define the part so that a computer numerical control cutter path can be easily programmed.

Machine Zero Point

The machine zero point can be set by three methods—by the operator, manually by a programmed absolute zero shift, or by work coordinates, to suit the holding fixture or the part to be machined.

MANUAL SETTING - The operator can use the MCU controls to locate the spindle over the desired part zero and then set the X and Y coordinate registers on the console to zero.

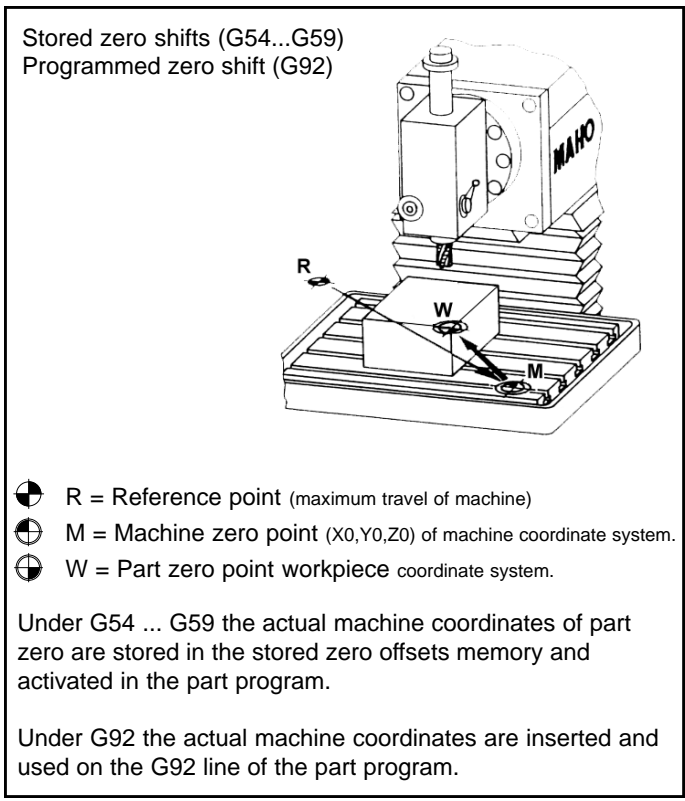


Fig. 19 The relationship between the part zero and the machine system of coordinates. (Deckel Maho, Inc.)

ABSOLUTE ZERO SHIFT - The absolute zero shift can change the position of the coordinate system by a command in the CNC program. The programmer first sends the machine spindle to home zero position by a G28 command in the program. Then another command (G92 for absolute zero shift) tells the MCU how far from the home zero location, the coordinate system origin is to be positioned, Fig. 19.

The sample commands may be as follows:

```
N1 G28 X0 Y0 Z0 (sends spindle to home zero position)
N2 G92 X4.000 Y5.000 Z6.000 (the position the machine will
reference as part zero)
```

Work Settings and Offsets

All CNC machine tools require some form of work setting, tool setting, and offsets (compensation) to place the cutter and work in the proper relationship. Compensation allows the programmer to make adjustments for unexpected tooling and setup conditions.

Work Coordinates

In absolute positioning, work coordinates are generally set on one edge or corner of a part and all programming is generally taken from this position. In Fig. 20, the part zero is used for all positioning for hole locations 1, 2, and 3.

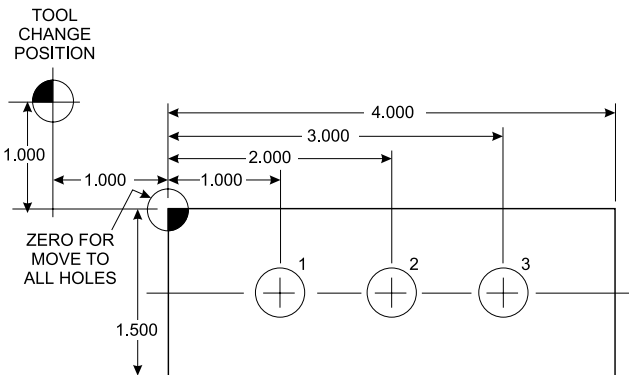


Fig. 20 In absolute programming, all dimensions must be taken from the XY zero at the top left-hand corner of the part. (Kelmar Associates)

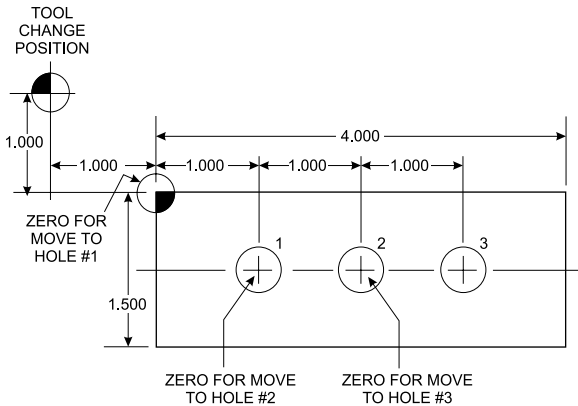


Fig. 21 In incremental programming, all dimensions are taken from the previous point. (Kelmar Associates)

In incremental positioning, the work coordinates change because each location is the zero point for the move to the next location, Fig. 21.

On some parts, it may be desirable to change from absolute to incremental, or vice versa, at certain points in the job. Inserting the G90 (absolute) or the G91 (incremental) command into the program at the point where the change is to be made can do this.

R Plane or Gage Height

The word-address letter R refers to a partial retraction point in the Z axis to which the end of the cutter retracts above the work surface to allow safe table movement in the X Y axes. It is often called the rapid-traverse distance, gage height, retract or work plane. The R distance is a specific height or distance above the work surface and is generally .100 in. above the highest surface of the workpiece, Fig. 22, which is also known as gage height. Some manufacturers build a gage height distance of .100 in. into the MCU (machine control unit) and whenever the feed motion in the Z axis is called for, .100 in. will automatically be added to the depth programmed.

When setting up cutting tools, the operator generally places a .100 in. thick gage on top of the highest surface of the workpiece. Each tool is lowered until it just touches the gage surface and then its

length is recorded on the tool list. Once the gage height has been set, it is not generally necessary to add the .100 in. to any future depth dimensions since most MCUs do this automatically.

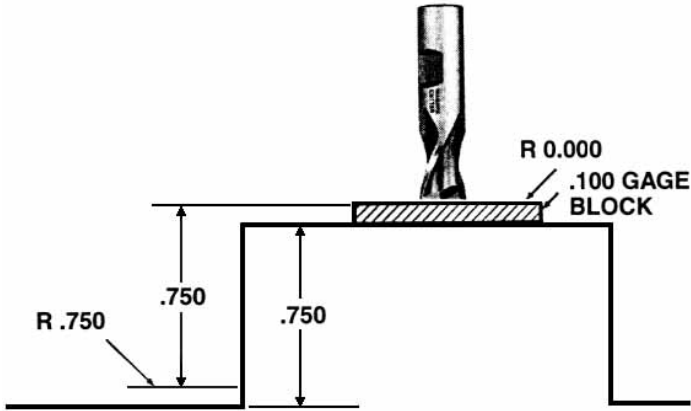


Fig. 22 Using a .100 in. gage block to set the gage height or R0 on the work surface. (Kelmar Associates)

Cutter Diameter Compensation

Cutter diameter compensation (CDC) changes a milling cutter's programmed centerline path to compensate for small differences in cutter diameter. On most MCUs, it is effective for most cuts made using either linear or circular interpolation in the X-Y axis, but does not affect the programmed Z-axis moves. Usually compensation is in increments of .0001 in. up to +1.0000 in., and usually most controls have as many CDCs available as there are tool pockets in the tool storage matrix.

The advantage of the CDC feature is that it:

1. allows the use of cutters that have been sharpened to a smaller diameter.
2. permits the use of a larger or smaller tool already in the machine's storage matrix.
3. allows backing the tool away when roughing cuts are required due to excessive material present.

- permits compensation for unexpected tool or part deflection, if the deflection is constant throughout the programmed path.

The basic reference point of the machine tool is never at the cutting edge of a milling cutter, but at some point on its periphery. If a 1.000 in. diameter end mill is used to machine the edges of a workpiece, the programmer would have to keep a .500 in. offset from the work surface in order to cut the edges accurately, Fig. 23. The .500 offset represents the distance from the centerline of the cutter or machine spindle to the edge of the part. Whenever a part is being machined, the programmer must calculate an offset path, which is usually half the cutter diameter.

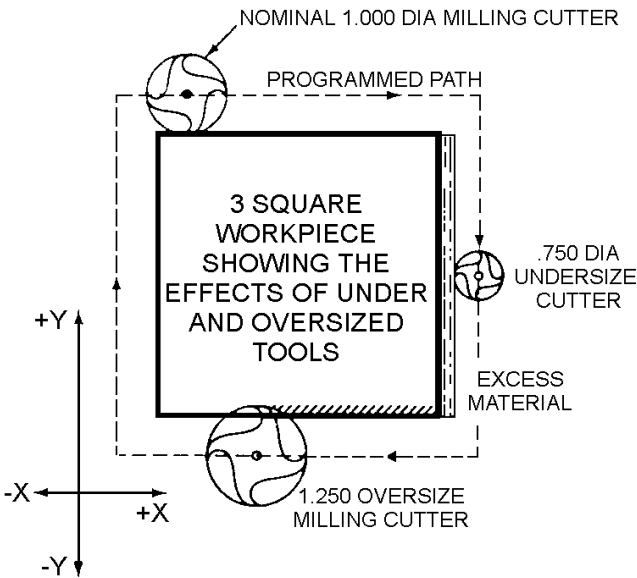


Fig. 23 Cutter-diameter compensation must be used when machining with various size cutters. (Kelmar Associates)

Modern MCUs, which have part surface programming, automatically calculate centerline offsets once the diameter of the cutter for each operation is programmed. Many MCUs have operator-entry capabilities which can compensate for differences in cutter diameters; therefore an oversize cutter, or one that has been sharpened, can be used as long as the compensation value for oversize or undersize cutters is entered.

CNC Bench-Top Milling and Turning Centers

Bench-top teaching machines are well suited for teaching purposes because neither the student or the teacher are intimidated by the size or complexity of the machines. They are easy to program and perform machining operations similar to industrial machines with smaller workpiece and lighter cuts. Bench-top machines are relatively inexpensive and ideal for teaching basic CNC programming.

Vertical machining centers and turning centers are the most common CNC machines used in industry. For teaching purposes, two types of CNC Bench-Top machines, the lathe and the mill, will be used because they use the same basic programming features and the Fanuc compatible controls as industrial machines. Most of the G and M codes are the same for CNC Bench-top teaching machines and industrial machines. Since programming codes do vary slightly with manufacturers, it is always wise to consult the programming manual for each specific machine to avoid crashes or scrap work.

*Fig. 24 Novamill
A compact 3 axis CNC bench milling machine suitable for all levels of education and technical training. The Novamill is controlled via a standard keyboard or Desk-Top Tutor connected to a PC. An optional 6 station Automatic Tool Changer (ATC) is also available. (Denford Inc.)*







The 3-axes bench-top CNC vertical machining center (mill) with the Fanuc compatible controller, Fig. 24, is ideal for teaching the basics of CNC mill programming. It includes all important G and M codes, milling cycles, subroutines, etc. and can be programmed in inch or metric dimensions in both incremental and absolute programming. Some models are equipped with a graphics display that allows the operator to test-run the program on the computer screen without cutting a part. This is a safe way to check the accuracy of a program, to prevent crashes and scrap work, without actually running the machine.



*Fig. 25 Novaturn
A compact 2 axis CNC bench turning center suitable for all levels of education and technical training. The Novaturn is controlled via a standard keyboard or Desk-Top Tutor connected to a PC.
(Denford Inc.)*

The CNC Bench-Top turning center (lathe), Fig. 25 is excellent for teaching the basics of CNC lathe programming. It uses the same standard G and M codes as the larger machines, can be programmed in inch or metric dimensions in both absolute and incremental programming. Many teaching machines also are equipped with canned cycle processing and canned thread-cutting cycles. Some models are equipped with a graphic display that allows a student to simulate (test run) the cutting action of the CNC program on the computer screen without actually cutting a part on the machine. This allows the student to check the program for accuracy and make corrections which avoids machine crashes, damage, and scrap parts.

CNC Programming Hints - MILLING

-  Machine reference point (maximum travel of machine)
-  Machine X Y zero point (could be tool change point)
-  Part X Y zero point (programming start point)
-  Indicates the tool change position. A G92 code will reset the axis register position coordinates to this position.

For a program to run on a machine, it must contain the following codes:

- M03 To start the spindle/cutter revolving.
- Sxxx The spindle speed code to set the r/min.
- Fxx The feed rate code to move the cutting tool or workpiece to the desired position.

ANGLES:

The X Y coordinates of the start point and end point of the angular surface plus a feed rate (F) are required.

Z CODES:

- A Z dimension raises the cutter above the work surface.
- A Z- dimension feeds the cutter into the work surface.
- Z.100 is the recommended retract distance above the work surface before a rapid move (G00) is made to another location.

RADII / CONTOUR Requirements:

- The *start* point of the arc (XY coordinates)
- The *direction* of cutter travel (G02 or G03)
- The *end* point of the arc (XY coordinates)
- The *center* point of the arc (IJ coordinates) or the arc radius)

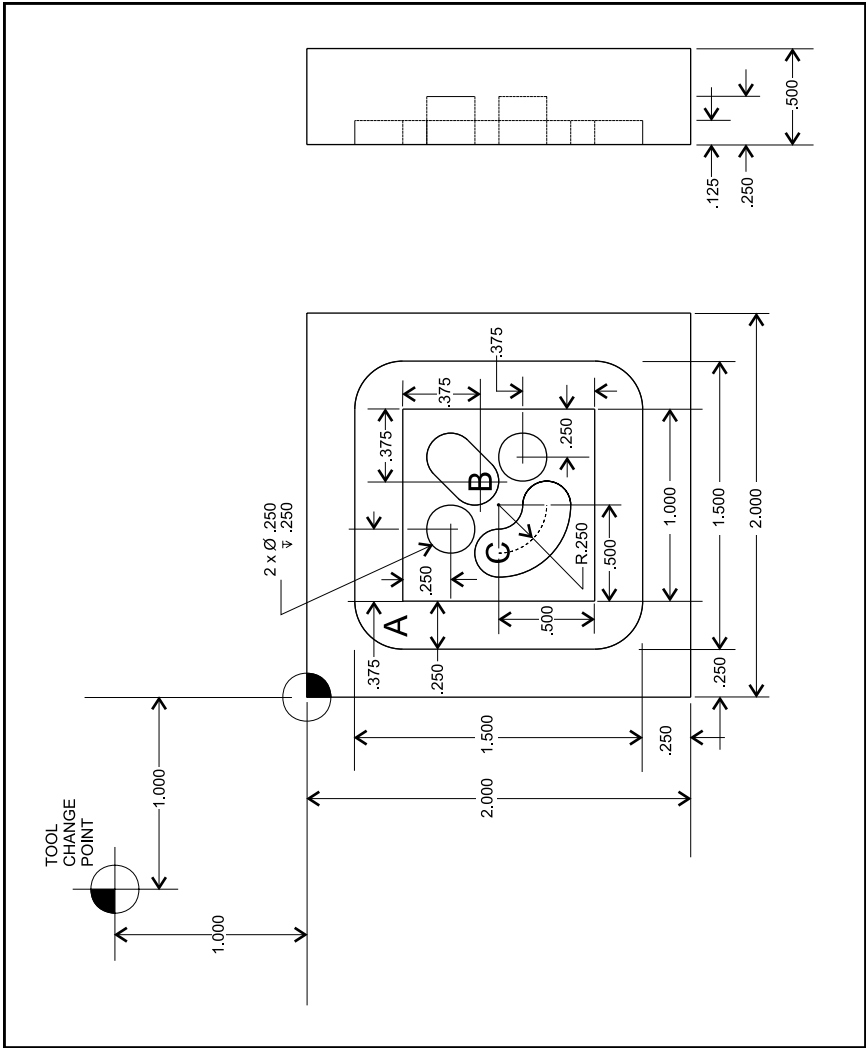


Fig. 26 A sample flat part used for CNC programming and machining (Kelmar Associates)

Milling and Drilling Programming

Program Notes: (Fig. 26)

- Program in the absolute mode starting at the tool change position at the top left corner of the print.
- The material is aluminum (300 CS), feedrate 10 in/min.
- The cutting tool is a .250 in. diameter high speed steel 2-flute end mill.
- Mill the 1 in. square slot.
- Drill the two .250 in. diameter holes, .250 in. deep.
- Mill the .250 in. wide angular slot, .125 in. deep.
- Mill the .250 in. wide circular groove, .125 in. deep.
- After the job is completed, return to the tool change position.

Programming:

% (rewind stop code / parity check)
2000 (program number)

N5 G92 X-1.000 Y1.000 Z1.000

G92 programmed offset of reference point (tool change position)
X-1.000 tool set at 1.000 to the left of the part.
Y1.000 tool set at 1.000 above the top edge of the part.
Z1.000 the end of the cutter is 1.000 above the top surface of the part.

N10 G20 G90

G20 inch data input.
G90 absolute programming mode.

N15 M06 T01

M06 tool change command.
T01 tool no. 1 (.250 diameter, 2-flute end mill).

N20 S2000 M03

S2000 spindle speed set at 2000 r/min.
M03 spindle on clockwise.

N25 G00 X0 Y0 Z.100

G00 rapid traverse rate to X0 Y0 at the top left corner of the part.
Z.100 tool rapids down to within .100 of the work surface.

Machining the square groove

N30 X.375 Y-.375

tool rapids to position A.

N35 G01 Z-.125 F10

G01 linear interpolation.
Z-.125 tool feeds .125 below the work surface.
F10 feed rate set at 10 in./min.

N40 X1.625 Y-.375

X1.625 top groove cut to the right hand end.
Y-.375 measurement did not change because it was set in block N30.

N45 Y-1.625

Y-1.625 right hand side of the groove cut.

N50 X.375

X.375 bottom groove cut to the left side.

N55 Y-.375

Y-.375 left-hand side of groove cut; this completes the groove.

N60 G00 Z.100

G00 rapid traverse mode.
Z.100 tool rapids to .100 above work surface.

Hole Drilling

N65 G00 X.875 Y-.750

tool rapids to the top left hole location.

N70 G01 Z-.250 F10

tool feeds .250 into work at 10 in./min. to drill the first hole.

N75 G00 Z.100

tool rapids out of hole to .100 above work surface.

N80 X1.250 Y-1.125

tool rapids to second hole location.

N85 G01 Z-.250 F10

tool feeds .250 into work at 10 in./min. to drill the second hole.

N90 G00 Z.100

tool rapids out of hole to .100 above work surface.

Machining the Angular Slot

N95 X1.125 Y-.875 (location B)

tool rapids to the start of the angular slot.

N100 G01 Z-.125 F10

G01 linear interpolation.

Z-.125 tool feeds to .125 below the work surface.

F10 feed rate set at 10 in./min.

N105 X1.250 Y-.750

angular slot cut to top right corner.

N110 G00 Z.100

tool rapids to .100 above work surface.

Machining the Circular Groove

N115 X.750 Y-1.000 (location C)

tool rapids to start of circular groove.

N120 G01 Z-.125 F10

tool feeds to .125 below the work surface.

N125 G03 X1.000 Y-1.250 R.250

G03 circular interpolation counterclockwise
X & Y location of end of circular groove.
R.250 radius of arc is .250.

N130 G00 Z.100

tool rapids to .100 above work surface.

N135 X-1.000 Y1.000

tool rapids back to tool change position.

N140 M05

M05 spindle turned off.

N145 M30

M30 end of program

CNC Programming Hints - TURNING



Indicates the X Z 0 (zero) location which is the starting point for programming.



Indicates the tool-change position.

A G92 code will reset the axis register position coordinates to this position.

For a program to run on a machine, it must contain the following codes:

M03 To start the spindle/cutter revolving.
Sxxx The spindle speed code to set the r/min.
Fxx The feedrate code to move the cutting tool or
 workpiece to the desired position.

TAPERS/BEVELS/ANGLES

- The X Z coordinates of the small diameter, the large diameter, and a feedrate must be programmed.
- Z moves the cutting tool longitudinally away from the end of the workpiece.
- Z- moves the cutting tool along the length of the workpiece towards the chuck (headstock).
- X moves the cutting tool away from the work diameter.
- X- moves the cutting tool into the work diameter.

Fanuc Compatible Programming

The programming for the Fanuc compatible control is the one most commonly used in industry. Although many controls are similar to the Fanuc control, there are some differences. A few of the main differences are:

- 1.) The G28 code is used to set the programmed offset of the reference point.
- 2.) Codes are modal and do not have to be repeated in every sequence line.
- 3.) All dimensions are entered as decimals.

Using the part illustrated in Fig. 27 the programming for a Fanuc compatible control would be as follows:

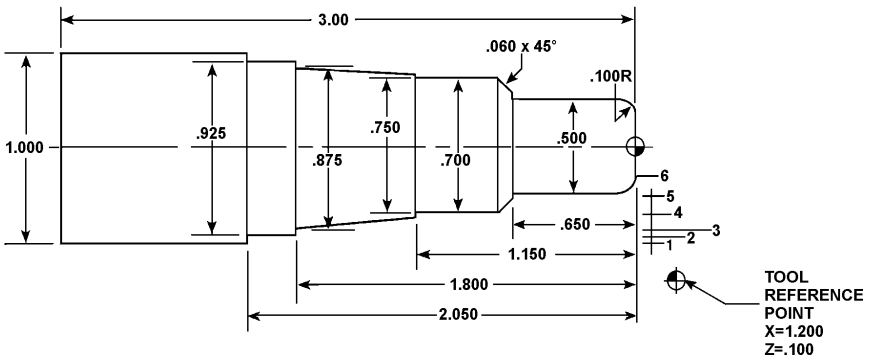


Fig. 27 A typical round part used for CNC programming and machining. (Kelmar Associates)

Turning Programming

Programming Sequence

% (rewind stop code/parity check)
2001 (program number)

N05 G20 G90 G40

G20 inch data input.
G90 absolute positioning mode
G40 cancels tool radius compensation.

N10 G95 G96 S2000 M03

G95 feed rate per revolution.
G96 constant feed rate.
S2000 spindle speed set at 2000 r/min.
M03 spindle ON clockwise.

N15 T0202

tool number and offsets.

N20 G00 X1.200 Z.100

G00 rapid traverse mode.
X&Z tool reference or change point.
X1.200 tool point .100 away from the outside diameter.
Z.100 tool point .100 to the right of end of work.

Rough Turning Cycle

N25 G73 U.05 R.05

G73 rough turning cycle.
U.05 .050 allowance on diameter for finish cut.
R.05 tool nose radius.

N30 G73 P35 Q95 U.025 W.005 F.008

P35 start block of rough contour cycle.
Q95 end block of rough contour cycle.
W.005 shoulder allowance for finish cut.
F.008 feed rate at .008 per revolution.

N35 G00 X.300 Z.050

G00 rapid traverse mode.
X.300 tool point at .300 diameter for start of .100 radius.
Z.050 tool point .050 away from end of the part.

N40 G01 Z0

G01 linear interpolation (feed).
Z0 tool point touching end of the work.

N45 G03 X.500 Z-.100 R.100

G03 circular interpolation (counterclockwise).
X.500 largest diameter of radius.
Z-100 end of radius on .500 diameter.
R.100 size of the radius.

N50 G01 Z-.650

G01 linear interpolation.
Z-.650 machines .500 diameter to .650 length.

N55 X.580

X.580 tool moves out to the small diameter of .060 x 45° bevel.

N60 X.700 Z-.710

X.700 large diameter of bevel.
Z-.710 end distance of bevel.

N65 Z-1.150

Z-1.150 the .700 diameter cut to 1.150 length.

N70 X.750

X.750 cutting tool feeds out to .750 (small end of taper).

N75 X.875 Z-1.800 (cutting taper)

X.875 large end of taper.
Z-1.800 length that taper is cut.

N80 X.925

X.925 tool feeds out (faces) to .925 diameter.

N85 Z-2.050

Z-2.050 the .925 diameter is cut to 2.050 length.

N90 X1.050

X1.050 the tool is fed out to .050 past the diameter of the part.

N95 G00 X1.200 Z.100 (tool back to tool reference point)

G00 rapid traverse mode.

X1.200 & Z.100 (reference point positions)

Finish Turning

N100 G72 P35 Q95 F.005

G72 finish turn cycle.

F.005 feed rate .005 per revolution.

N105 G00 X2.000 Z.500

G00 rapid traverse mode.

X2.000 & Z.500 machine home position.

N110 M30

M30 end of program

% Rewind code.

TEXTBOOK ADOPTION

Industrial Press, Inc.

Technical and Reference Publishers
for Industry and Education

Faculty Members

For an examination copy of one of our textbooks for course adoption, please include the following information on school letterhead:

Course title and number

Department name

Date course will be taught

Anticipated enrollment

Please mail, fax or e-mail your request to:

Marketing Director
Industrial Press, Inc.
200 Madison Avenue
New York, New York 10016-4078

FAX: 212-545-8327
induspress@aol.com

QUICK & EASY WAYS TO CONTACT INDUSTRIAL PRESS



BY MAIL

Industrial Press, Inc.
200 Madison Avenue
New York, NY 10016-4078



BY PHONE

Toll-Free in U.S.: 888-528-7852
Worldwide: 212-889-6330



BY FAX

212-545-8327



BY EMAIL

induspress@aol.com

If you are placing an order, please provide the following information:

- Author, Title, ISBN (if available), and Quantity
- Complete shipping address (and billing address, if different)
- Name and telephone (or email address) of contact person

90 Years of Industry Information in One Place!

Machinery's Handbook 27th Edition

By Oberg, Jones, Horton and Ryffel Editors: McCauley, Heald, and Hussain

Both print versions are: Thumb Indexed and 2,704 pages

Original "Toolbox" Edition 5"x 7"

ISBN 0-8311-2700-7, \$85.00

NEW


"Larger-Print" Edition 7"x 10"

ISBN 0-8311-2711-2, \$99.95

Celebrating its 90th year, the newest edition of "The Bible of the metalworking Industries," brings together volumes of knowledge, information, and data, gathered, revised, and improved upon by experts throughout the mechanical industries. Extraordinarily comprehensive yet easy to use since its first printing, *Machinery's Handbook* provides mechanical and manufacturing engineers, designers, draftsmen, toolmakers, machinists and students with a broad range of material, from the very basic to the more advanced. As always, it continues to provide industry fundamentals and standards while it leaps ahead into the 21st century with material reflecting technological advances and offering vast editorial improvements, making the 27th Edition the best tool ...ever!

Table of Contents

Mathematics. Mechanics and Strength of Materials. Properties, Treatment, and Testing of Materials. Dimensioning, Gaging, and Measuring. Tooling and Toolmaking. Machining Operations. Manufacturing Processes. Fasteners. Threads and Threading. Gears, Splines, and Cams. Machine Elements. Measuring Units. Index. Index of Standards. Index of Interactive Equations.

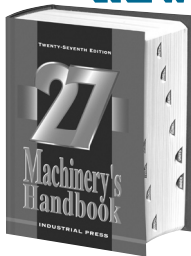

Exciting New Features

*A new more usable organization...every section has been reformatted so that you will never have to search outside that area for information on the topic you are studying.

*30% more Math coverage... from the basic to the advanced, you'll find fractions, positive and negative numbers, derivatives and integrals, analytical geometry, circular segments, matrices and engineering economics.

*New indexes... standards, reworked units and chapters, and interactive equations.

*New or revised material on cutting tools, screw threads, symbols and abbreviations, threads and threading, disk springs, properties and materials, sine bars, and sheet metal.

*Updated Standards.



Machinery's Handbook Pocket Companion

By Dick Pohanish and Chris McCauley

2000, 352 pp., illus., ISBN 0-8311-3089-X, \$19.95

An extremely concise yet completely authoritative ready-reference which draws its content largely from Machinery's Handbook. This book is designed for anyone in the machine trades for whom convenient access to just the most basic data is at a premium. The Pocket Companion will not replace the Handbook but instead will serve as a handy complement to the latter's vastly larger compilation of data, standards, and text.

Now with *Interactive Math!**

NEW



Machinery's Handbook, 27th Edition CD-ROM

By McCauley, Oberg, Jones, Horton, and Ryffel, Editors: Heald and Hussain

CD-ROM Only ISBN 0-8311-2777-5 \$89.95

COMBO SPECIAL CD-ROM + "Toolbox" Handbook 27th Edition ISBN 0-8311-2727-9 \$149.95

COMBO SPECIAL CD-ROM + "Larger-Print" Handbook 27th Edition ISBN 0-8311-2737-6 \$159.95

Upgrade for your current CD version ISBN 0-8311-2790-2 \$65.95

(Visit our website or send us an email at cdupgrade@industrialpress.com to find out what you need to do to qualify for the upgrade program/price.)

Get ready, get set...and take advantage of ready access to hundreds of critical math equations from the premier reference in its field with a push of a button! Now *Machinery's Handbook 27th Edition CD-ROM* provides what many of you have been asking for...**INTERACTIVE MATH**. With a simple internet connection you'll be able to instantly calculate cutting speeds, moments of inertia, the measurement of various screw threads, the center of gravity for any shape, hardness of material, volumes, taper angles, matrices, and much, much more. In addition, the new *27th Edition CD* continues to combine the complete contents of the *Handbook* with the power, versatility, and convenience of Adobe PDF. These compact files can be viewed, navigated, and printed exactly as they appear by anyone with Adobe Acrobat Reader, which is included free on this disk. Now more than ever the CD combined with print edition is the most powerful tool you'll need to easily and effectively perform your job!

*Interactive math requires an Internet connection. Minimum Requirements – 486 PC processor or higher; Windows 95, 98, ME, NT, 2000, XP; 10MB RAM for Windows 95/98, 16MB RAM for Windows NT; 10MB available HD space, CD-ROM drive, VGA or higher resolution color monitor, Windows-compatible printer.

Contact Industrial Press for Information about Site Licensing.

NEW

Machinery's Handbook Guide, 27th Edition

By Amiss, Jones, and Ryffel Editors: Green, McCauley, Heald and Hussain

2004, 254 pages, ISBN 0-8311-2799-6, \$12.95



Completely updated to reflect the changes and additions made to the Handbook. Throughout the *Guide*, you will find useful information on how to make full use of the Handbook to solve problems encountered on the job. In addition to offering a wealth of time-saving data that can help in almost any situation, it includes over 500 examples and questions (with answers) specially selected for engineers and apprentices. Combines the complete contents of the 27th edition Machinery's Handbook of the world-renowned reference for the mechanical industries.

Also available on the CD as an additional purchase.

Toll Free 888-528-7852

Fax 212-545-8327

www.industrialpress.com